vin - 247

J.T. HERITAGE SALES AND SERVICE INC.

2025 BAR M SS-21-SR

(2 Horse Straight Load With Side Ramp)

STANDARD FEATURES

Frame And Structure Standards

- Aluminum frame.
- Aluminum side wall posts and aluminum roof bows. Sidewall posts are 1 1/1" deep and typically on 16" centres.
- Flooring cross members (commonly on 12" centres).
- One piece, seamless aluminum roof.
- Exterior aluminum skin (.40, white is standard.) Nose sheet are riveted.
- Dexter Spring axles (3,500 pounds is standard)
- Electric brakes on all axles.
- (4) Steel wheels & (1) steel wheel for spare (15" LR D). Spare tire installed inside dressing room.
- Heavy duty 2 5/16" coupler with safety chains.

Horse Area Interior Standards

- HDPE smooth black high impact wall liner on road and curb side of horse area.
- HDPE smooth black high impact wall liner on rear side of dressing room wall.
- Large, single, radius corner, sliding window on curb side wall in horse area near butt side.
- Radius corner drop down feed door on curb side wall in horse area near head side. (Non-ramp model only)
- Large, single, radius corner, sliding window on road side wall in horse area near butt side.
- Radius corner drop down feed door on road side wall in horse area near head side.
- (1) Slim line LED stall light per stall installed in cove (1) on curb side & (1) on road side.
- Built in partition wall with HDPE liner between front horse area dressing room.
- (2) Horse ties per stall inside of horse area.
- (1) Horse divider between the two stalls.

Exterior Standards

- (1) Exterior horse tie on the curb side rear hoop & (1) on the road side.
- Curb side door on non-side ramp street side on side ramp model.
- Ramp with 50/50 tail doors at the rear of the trailer. No windows in tail doors.
- Side Ramp model to have a ramp with tail door on the curb side near front of horse area. Drip cap above dressing room door made from aluminum angle.
- License plate light located curb side of the rear door, toward the lower section of the trailer.
- Location for license plate on road side of the rear ramp, toward the lower section of the trailer.
- Single set of LED turn/stop/tail-lights. Installed about 18" above horse area floor.
- (1) Door tie back on the rear road side tail door and (1) on the curb side tail door.
- (1) Door tie back on the road side dressing room door.
- Tear drop style aluminum fender with top side mounted fender light.
- Three piece skin coloured nose sheet. Nose sheets are riveted at the seams and centre posts. Large Bar-M nose decal. Centred on unit up, up high.
- (2) Red reflectors. One installed on road side rear and one on curb side rear, mid way up.
- (2) Amber reflectors. One installed on road side front and one on curb side, front mid way up.
- (2) Amber reflectors. One installed on road side nose and one on curb side nose, just below top rail.
- Bar M Logo on top-rail. Both road and curb sides near the rear of the trailer on the top rail.
- Bar M Logo on road side rear swinging door . Installed between the air gasps on the sheet. Bar M Logo installed on curb side dressing room door.
- Red/White conspicuity tape along the entire bottom side or rear swinging door.
- Red/White conspicuity tape along the lower side of road and curb side walls.
- White conspicuity tape in all "L" shape at the top of each corner of each tail door.
- Top crank jack installed in the coupler for the trailer.
- Emergency break away battery and switch. Diamond plate nose guard.
- (15) Upper clearance lights. (5) on rear, (3) on road & curb side top rail, (4) on front nose top-rail.
- (2) Lower clearance lights. Down low in stone guard (1) on curb side and (1) on road side.
- (2) Lower clearance lights (1) on curb side & (1) on road side just forward of rear hoop.

Dressing Room Standards

- Custom built camper door with 20" window
- Break away battery bow, battery and charger installed in dressing room.
- (1) Set of (8) bridle hooks installed on partition wall up high, near curb side of unit.
- Spare tire is installed in the dressing room.
- 2 Tier Saddle (one per horse).
- (1) Set of (8) bridle hooks bar.
- Walk-thru door in wall between the horse area and dressing room.

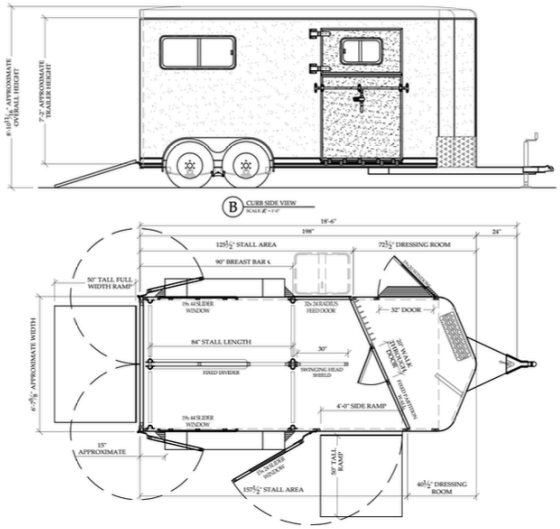

Optional Equipment Added

- Window with bar guards
- Rear load light with switch
- Aluminum wheels
- 6 Lug, 5,200 pound torsion axles & 16" load range E tires
- Shelby flooring – horse area (over aluminum I-beams)

Customer Care

- 2 YEAR HITCH TO BUMPER WARRANTY
- 8 YEAR STRUCTURAL WARRANTY

MSRP: $45,837

SALE PRICE: **$39,999**

YOUR PAYMENT

MONTHLY	BI-WEEKLY
$413 OAC	$190 OAC

TERM/AM	INTEREST RATE
180/180	8.20% APR 9.30%

OAC, finance fee of $599 included in payment, cost of credit during term: $31,621.54.

EMPTY WEIGHT	GVWR	AXLE
2,700 LB	10,400	(2) 5,200
LENGTH	**HEIGHT**	**WIDTH**
16'5"	7'6"	6'8 1/2"